


SAE 070123

Ref. Parker XHX7

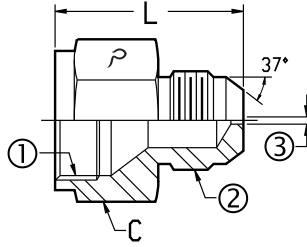

2406R
Restrictor JIC Tube Reducer

2406R-①-②-③ ①-FJ ②-MJ ③-Orifice	Tube O.D.	① Female JIC	② Male JIC	③ Orifice	C Hex	L Length	Operating Pressure
2406R-04-04-.000	1/4	7/16 - 20	7/16 - 20	Blank	9/16	1.15	5,000
2406R-04-04-.015	1/4	7/16 - 20	7/16 - 20	1/64	9/16	1.15	5,000
2406R-04-04-.022	1/4	7/16 - 20	7/16 - 20	.55mm	9/16	1.15	5,000
2406R-04-04-.031	1/4	7/16 - 20	7/16 - 20	1/32	9/16	1.15	5,000
2406R-04-04-.043	1/4	7/16 - 20	7/16 - 20	#57	9/16	1.15	5,000
2406R-04-04-.062	1/4	7/16 - 20	7/16 - 20	1/16	9/16	1.15	5,000
2406R-06-06-.000	3/8	9/16 - 18	9/16 - 18	Blank	11/16	1.18	5,000
2406R-06-06-.031	3/8	9/16 - 18	9/16 - 18	1/32	11/16	1.18	5,000
2406R-06-06-.062	3/8	9/16 - 18	9/16 - 18	1/16	11/16	1.18	5,000
2406R-06-06-.094	3/8	9/16 - 18	9/16 - 18	3/32	11/16	1.18	5,000
2406R-08-08-.000	1/2	3/4 - 16	3/4 - 16	Blank	7/8	1.41	5,000
2406R-08-08-.062	1/2	3/4 - 16	3/4 - 16	1/16	7/8	1.41	5,000

4:1 Safety Factor

More **RESTRICTOR** fittings

- | | |
|-----------------|-----------------|
| 1404R (pg. 43) | 6400R (pg. 134) |
| 1501R (pg. 47) | 6801R (pg. 157) |
| 2404R (pg. 70) | 6900R (pg. 167) |
| 2406R (pg. 73) | 6901R (pg. 169) |
| 5405R (pg. 114) | 6902R (pg. 171) |

i Informational Tips

CAUTION:
Brazing or Welding on plated surfaces can give off toxic fumes resulting in personal injury and/or death.